



Inlet Island Maintenance Company

(S Island Dr E, Bonney Lake WA, 98391)

3/21/24

This Park has a composite Playworld structure designed for children 5-12-year-olds. The area also has a 2-bay swing and standone tunnel and rocker. The surfacing is pea gravel.

Local Rep: [Northwest Playground Equipment | Commercial Playground Equipment & Design \(nwplayground.com\)](#) Derek Faber 253-553-7006 derek@nwplayground.com


It is my recommendation that this playground be closed to the public until the Priority Hazards 1&2 have been fixed.





Northwest Play Safe, LLC

Priority 1 Hazard- Recommendations #1: Head & Neck Entrapment. Contact [Northwest Playground Equipment | Commercial Playground Equipment & Design \(nwplayground.com\)](http://Northwest Playground Equipment | Commercial Playground Equipment & Design (nwplayground.com)) to replace tic-tac-toe panel.

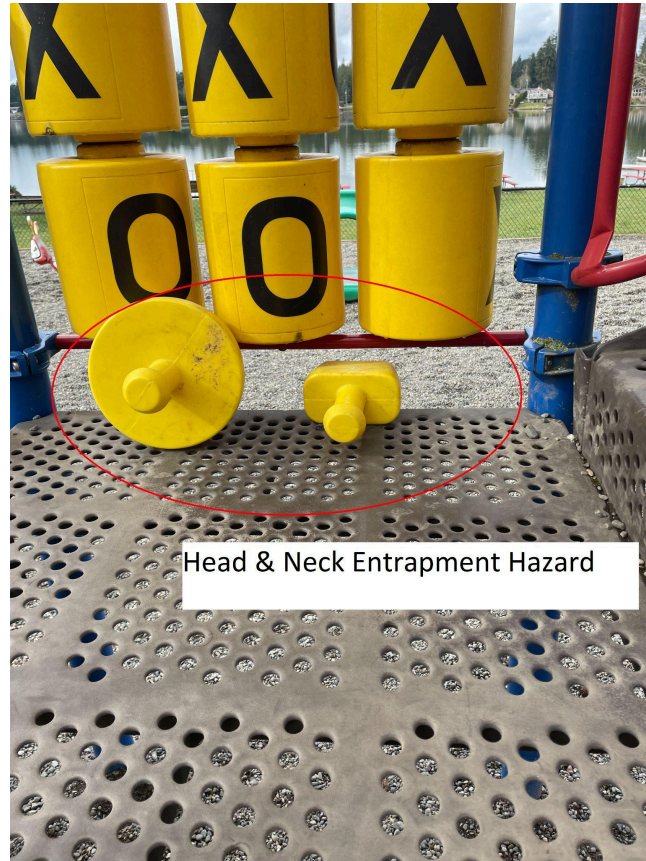


Priority 1 Hazard- Recommendation #2: Severely low safety surfacing. Add additional pea gravel to the entire play area. Add additional 6" of surfacing (pea gravel).



Resource for surfacing

[G & L Bark Supply - G & L Bark Supply \(g-lbarksupply.com\)](http://G & L Bark Supply - G & L Bark Supply (g-lbarksupply.com))

[410 Quarry LLC - Rock, Landscaping, Bark \(410landscapesupply.com\)](http://410 Quarry LLC - Rock, Landscaping, Bark (410landscapesupply.com))

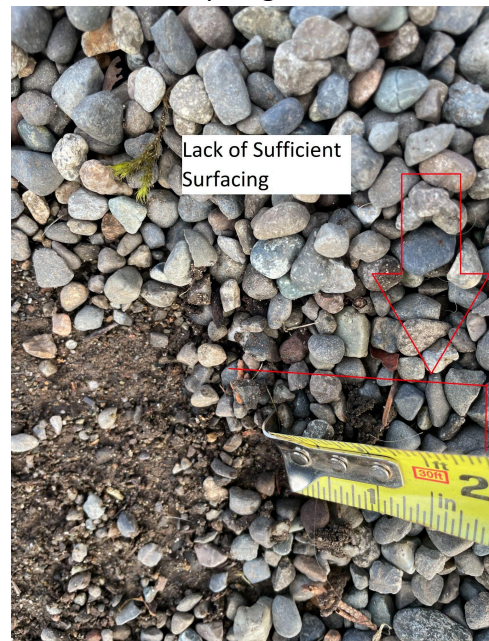

Priority 2 Hazard-Recommendations #3: Lack of a use zone. The swing requires 20' of use zone to and fro. Remove swing and replace with a shorter swing that does not require so much space.

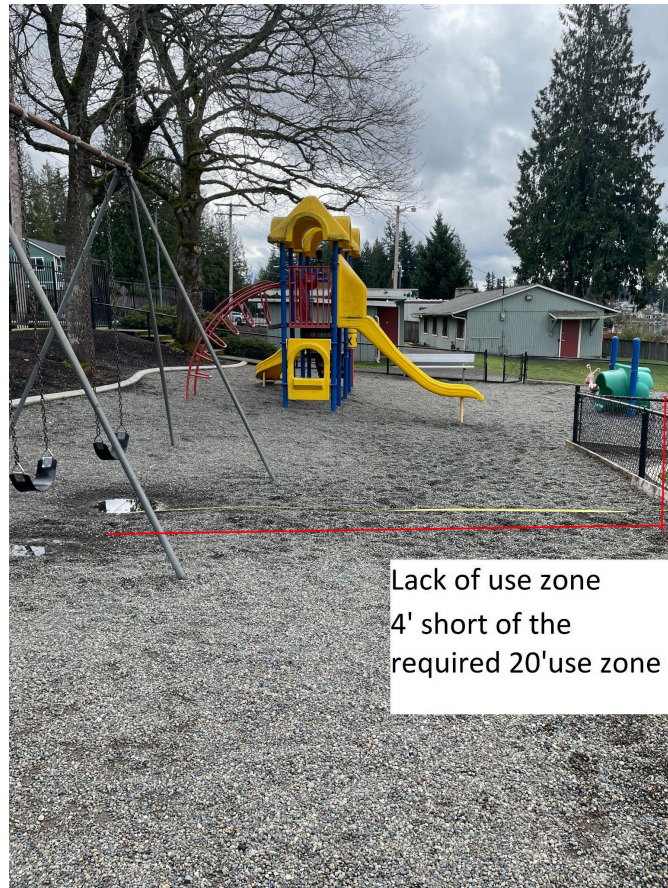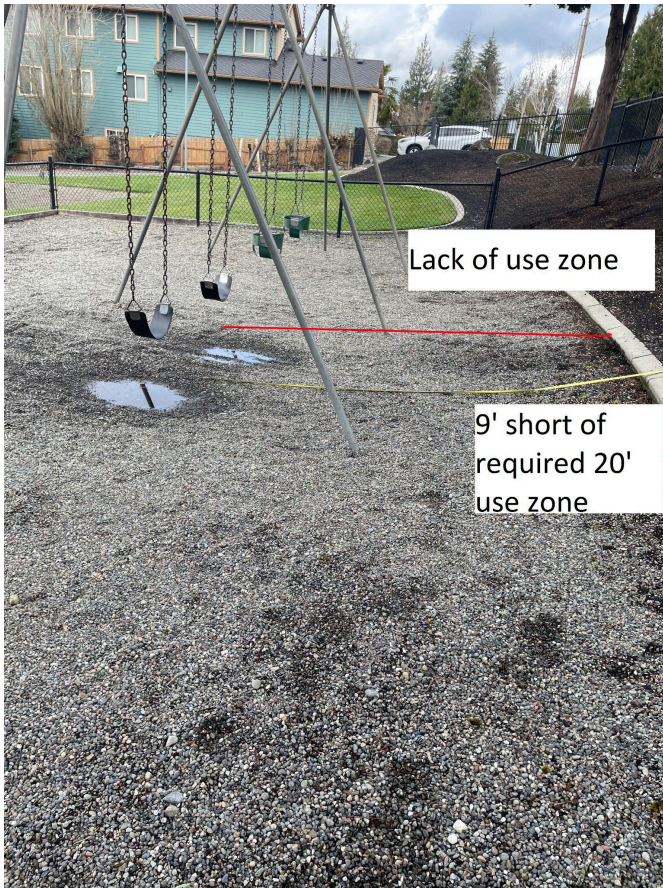

Priority 2 Hazard-Recommendations #4: Lack of a use zone. The arch climber requires a 6' use zone. Add an additional 14" of required use zone.



Priority 2 Hazard-Recommendations #5: Remove or replace the old rocker. It has a dangerous crush and shear area.



Priority 2 Hazard-Recommendations #6: Remove overhead obstruction by trimming back branches 7' from the top of the play structure.





Northwest Play Safe, LLC

Priority 3 Hazard-Recommendations #7: Low level powerwash all plastics.



Priority 3 Hazard-Recommendations #8: Add age appropriate stickers (5-12 years old) and or signage to the area.

Signage: [Playground Signs | Signs for Playgrounds \(smartsign.com\)](https://www.smartsign.com)

Age appropriate Stickers: [Playground Safety Stickers – Trassig - The Playground People](https://www.trassig.com)



Strangulation Warning label



"Hot Surface" Warning label



Surface Warning label



Ages 2-5 label



Ages 5-12 label



Ages 2-12 label



Tot Seat label



Supervision label



Recommended Local Playground Manufacturers

Northwest Playground

Doug Nelson Doug@nwplayground.com

Parks Consultant - *Western Washington*

[Northwest Playground Equipment | Commercial Playground Equipment & Design \(nwplayground.com\)](http://nwplayground.com)

Mobile: 253-740-0075

Pacific Outdoor Products

Hansen Pitts

Parks Consultant - *Western Washington*

[Outdoor Play Ground Equipment - Pacific Outdoor Products](http://pacificoutdoorproducts.com)

Mobile: 425-358-7948

Submitted By: *Courtney Brown*

Date: 3/25/23